

Computer Aided Geometric Design

Transformations

Instructor: Dr. Prashant K. Jain

Professor (ME Discipline)

PDPM Indian Institute of Information Technology,
Design and Manufacturing Jabalpur, Jabalpur, INDIA

Resources: web.iitdmj.ac.in/~pkjain/

Email: pkjain@iitdmj.ac.in, pkjain2006@gmail.com

<http://www.iitdmj.ac.in/Faculty/pkjain.html>

<http://in.linkedin.com/in/pkjain2006>

<https://www.facebook.com/pkjain2006>





PDPM

INDIAN INSTITUTE OF INFORMATION TECHNOLOGY,
DESIGN AND MANUFACTURING JABALPUR

(An Institute of National Importance (INI) established by MHRD, Govt. of INDIA)

Transformations

- Translation
- Scaling
- Rotation
- Shear
- Reflection
- Matrix Notation
- Compositions/concatenation
- Homogeneous coordinates

August 25, 2024

Dr. Prashant K. Jain (IITDMJ)

3

Geometric Transformation

- Move points in space from one location to another
- Change the description of a point from one coordinate system to other like WCS to MCS
- Relative distance between object particles remain constant
- Referred as rigid body motion/transformation
- Include translation, scaling, reflection, rotation or combination

August 25, 2024

Dr. Prashant K. Jain (IITDMJ)


4

New position vector p' expressed in terms of the old position vector p and the motion parameters.

$$P' = f(p, \text{transformation parameters})$$

$$P' = [T] P$$

$[T]$ transformation matrix

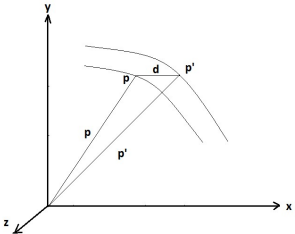

August 25, 2024

Dr. Prashant K. Jain (IITDMJ)

5

Transformations

- Assumption:** Objects consist of points and lines. A point is represented by its Cartesian coordinates:
$$P = (x, y)$$
- Geometric Transformation:**
Let (A, B) be a straight line segment between the points A and B.
Let T be a general 2D transformation.
T transforms (A, B) into another straight line segment (A', B'), where:
$$A' = TA \text{ and}$$
$$B' = TB$$


August 25, 2024

Dr. Prashant K. Jain (IITDMJ)

6

Transformations

- Rotation
- Translation
- Scaling (uniform/non-uniform)
- Reflection
- Shear

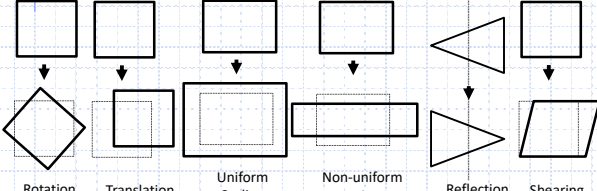

August 25, 2024

Dr. Prashant K. Jain (IITDMJ)


7

Translation


- Rigid motion of points to new locations
$$x' = x + d_x$$
$$y' = y + d_y$$
- Defined with column vectors:
$$\begin{bmatrix} x' \\ y' \end{bmatrix} = \begin{bmatrix} x \\ y \end{bmatrix} + \begin{bmatrix} d_x \\ d_y \end{bmatrix}$$

as $P' = P + T$

Before translation



After translation



August 25, 2024

Dr. Prashant K. Jain (IITDM)


8

Translation

When every entity of a geometric model remains parallel to its initial position. It involves moving the elements from one location to another.

For a point

$$p' = p + d$$
$$x' = x + x_d$$
$$y' = y + y_d$$
$$z' = z + z_d$$

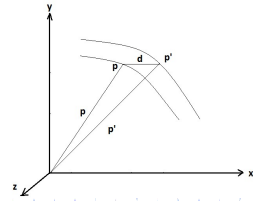

$$[x', y', z'] = [x, y, z] \cdot [T]$$
$$[T] = [x_d, y_d, z_d]^T \text{ Transformation matrix}$$

August 25, 2024


Dr. Prashant K. Jain (IITDM)

9

Scaling

- Used to change, increase or decrease the size of an entity or a model.
- Scaling is about the origin, that is a model changes size and location with respect to the origin. Model gets close or away from origin depending on scaling factor.
- Stretching of points along axes:
$$x' = S_x * x$$
$$y' = S_y * y$$
- In matrix form:
$$\begin{bmatrix} x' \\ y' \end{bmatrix} = \begin{bmatrix} S_x & 0 \\ 0 & S_y \end{bmatrix} \cdot \begin{bmatrix} x \\ y \end{bmatrix}$$

Or just $P' = S \cdot P$

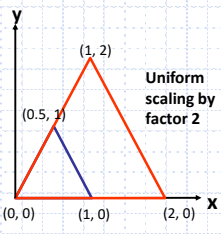

Uniform scaling by factor 2

August 25, 2024

Dr. Prashant K. Jain (IITDM)


10

Rotation

Enables users to view geometric models from different angles.

Rotation has a unique characteristics that is not shared by translations, scaling, or reflection that is non-commutative ness.

Two subsequent rotations of an entity about two different axes produce two different configurations for the entity depending on the order of the rotations.

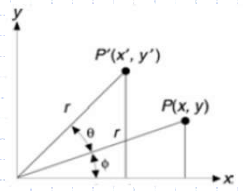

August 25, 2024

Dr. Prashant K. Jain (IITDM)

11


Rotation

- Rotation of points about the origin


$$x = r \cdot \cos\phi$$
$$y = r \cdot \sin\phi$$
$$x' = r \cdot \cos(\theta + \phi)$$
$$x' = r \cdot \cos\phi \cdot \cos\theta - r \cdot \sin\phi \cdot \sin\theta$$
$$y' = r \cdot \sin(\theta + \phi)$$
$$y' = r \cdot \cos\phi \cdot \sin\theta + r \cdot \sin\phi \cdot \cos\theta$$
$$x' = x \cdot \cos\theta - y \cdot \sin\theta$$
$$y' = x \cdot \sin\theta + y \cdot \cos\theta$$
$$\begin{bmatrix} x' \\ y' \end{bmatrix} = \begin{bmatrix} \cos\theta & -\sin\theta \\ \sin\theta & \cos\theta \end{bmatrix} \cdot \begin{bmatrix} x \\ y \end{bmatrix}$$

$P' = R \cdot P$

Before rotation



Before rotation



August 25, 2024

Dr. Prashant K. Jain (IITDM)

12

Rotation in 3D

$$[R_z] = \begin{bmatrix} \cos\theta & -\sin\theta & 0 \\ \sin\theta & \cos\theta & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ 1 \end{bmatrix}$$

Similarly

$$[R_x] = \begin{bmatrix} 1 & 0 & 0 \\ 0 & \cos\theta & -\sin\theta \\ 0 & \sin\theta & \cos\theta \end{bmatrix}$$
$$[R_y] = \begin{bmatrix} \cos\theta & 0 & -\sin\theta \\ 0 & 1 & 0 \\ \sin\theta & 0 & \cos\theta \end{bmatrix}$$


August 25, 2024

Dr. Prashant K. Jain (IITDM)

14

Reflection

Useful in constructing symmetric models, a geometric element can be reflected through a plane, a line or a point in space. Reflecting an entity through a principal plane is equivalent to negating the corresponding coordinate of each point on the entity, reflection through an axis is equivalent to reflection through two principal planes that intersect at the given axis.

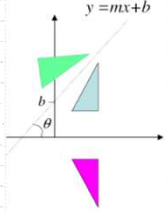

August 25, 2024

Dr. Prashant K. Jain (IITDM)

15

Reflection

If an object P in xy plane is to be reflected about the x-axis i.e. y=0.

Reflection of a point (x, y) is

$$\begin{bmatrix} x' \\ y' \\ z' \end{bmatrix} = \begin{bmatrix} x \\ -y \\ z' \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ z \end{bmatrix} = Rfx \begin{bmatrix} x \\ y \\ z \end{bmatrix}$$
$$P' = [M].P$$
$$M = \begin{bmatrix} m_{11} & 0 & 0 \\ 0 & m_{22} & 0 \\ 0 & 0 & m_{33} \end{bmatrix} = \begin{bmatrix} \pm 1 & 0 & 0 \\ 0 & \pm 1 & 0 \\ 0 & 0 & \pm 1 \end{bmatrix}$$


August 25, 2024

Dr. Prashant K. Jain (IITDM)

16

Reflection

Reflection is a special case of rotation when angle of rotation is 180° about an axis.

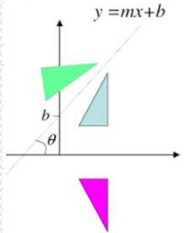

August 25, 2024

Dr. Prashant K. Jain (IITDM)

17

Shear

Produce distortion of an entity

will shear the point along the x-axis.

$$\begin{bmatrix} x' \\ y' \\ z' \end{bmatrix} = \begin{bmatrix} 1 & Sh_x & 0 \\ 0 & 1 & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ z \end{bmatrix} = \begin{bmatrix} x + Sh_xy \\ y \\ z \end{bmatrix}$$

will shear the point along the y-axis.

$$\begin{bmatrix} x' \\ y' \\ z' \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 \\ Sh_y & 1 & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ z \end{bmatrix} = \begin{bmatrix} x \\ y + Sh_yx \\ z \end{bmatrix}$$

August 25, 2024

Dr. Prashant K. Jain (IITDM)

18

Column V/s Row syntax

$$\begin{bmatrix} x' \\ y' \\ 1 \end{bmatrix} = \begin{bmatrix} \cos\theta & -\sin\theta \\ \sin\theta & \cos\theta \end{bmatrix} \cdot \begin{bmatrix} x \\ y \end{bmatrix}$$
$$[x' \ y'] = [x \ y] \cdot \begin{bmatrix} \cos\theta & \sin\theta \\ -\sin\theta & \cos\theta \end{bmatrix}$$

August 25, 2024

Dr. Prashant K. Jain (IITDM)

19

Matrix Representation for 2D Transformation

Column Format

- Translation: $\begin{bmatrix} x' \\ y' \\ 1 \end{bmatrix} = \begin{bmatrix} 1 & 0 & d_x \\ 0 & 1 & d_y \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ 1 \end{bmatrix}$
- Scale: $\begin{bmatrix} x' \\ y' \\ 1 \end{bmatrix} = \begin{bmatrix} S_x & 0 & 0 \\ 0 & S_y & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ 1 \end{bmatrix}$
- Rotation: $\begin{bmatrix} x' \\ y' \\ 1 \end{bmatrix} = \begin{bmatrix} \cos\theta & -\sin\theta & 0 \\ \sin\theta & \cos\theta & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ 1 \end{bmatrix}$
- Shear: $SH_x = \begin{bmatrix} 1 & a & 0 \\ 0 & 1 & 0 \\ 0 & 0 & 1 \end{bmatrix}$
- Reflection: $F_y = \begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & 1 \end{bmatrix}$

August 25, 2024

Dr. Prashant K. Jain (IITDM)

20

Matrix Representation for 2D Transformation

Row Format

- Translation: $[x' \ y' \ 1] = [x \ y \ 1] \begin{bmatrix} 1 & 0 & 0 \\ 0 & 1 & 0 \\ d_x & d_y & 1 \end{bmatrix}$
- Scale: $[x' \ y' \ 1] = [x \ y \ 1] \begin{bmatrix} S_x & 0 & 0 \\ 0 & S_y & 0 \\ 0 & 0 & 1 \end{bmatrix}$
- Rotation: $[x' \ y' \ 1] = [x \ y \ 1] \begin{bmatrix} \cos\theta & \sin\theta & 0 \\ -\sin\theta & \cos\theta & 0 \\ 0 & 0 & 1 \end{bmatrix}$
- Shear: $SH_x = \begin{bmatrix} 1 & 0 & 0 \\ a & 1 & 0 \\ 0 & 0 & 1 \end{bmatrix}$
- Reflection: $F_y = \begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & 1 \end{bmatrix}$

August 25, 2024Dr. Prashant K. Jain (IIITDM)21

Homogeneous Representation

- Rotation, scaling, shearing, reflection are in the form of matrix multiplication, but the translation takes the form of vector addition. This makes it inconvenient to concatenate transformation involving translation. It is desirable to express all geometric transformations in the form of matrix multiplication on representing points by their homogeneous coordinates.
- Provides an effective way to unify the description of geometric transformations as matrix multiplication.
- In homogeneous coordinates, an n-dimensional space is mapped into (n+1) dimensional space that is a point P(x,y,z) has homogeneous coordinates (x',y',z',h) where h is any scalar factor which is not equal to 0.

August 25, 2024Dr. Prashant K. Jain (IIITDM)22

Homogeneous coordinates

- A point in homogeneous coordinates (x, y, z, h), h≠0, corresponds to the 3-D vertex (x/h, y/h, z/h) in Cartesian coordinates.
- Homogeneous coordinates in 3D give rise to 4 dimensional position vector

$x = \frac{x'}{h}, y = \frac{y'}{h}, z = \frac{z'}{h}$

Translation matrices can now be written as:

$$[x' \ y' \ z' \ 1] = [x \ y \ z \ 1] \times \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ x_d & y_d & z_d & 1 \end{bmatrix}$$

August 25, 2024Dr. Prashant K. Jain (IIITDM)23


Rotation about an arbitrary point

- Rotate about a point P

$T(x_1, y_1) \cdot R(\theta) \cdot T(-x_1, -y_1)$

- Translate P1 to origin
- Rotate
- Translate back to P1

$$= \begin{bmatrix} 1 & 0 & x_1 \\ 0 & 1 & y_1 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} \cos\theta & -\sin\theta & 0 \\ \sin\theta & \cos\theta & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} 1 & 0 & -x_1 \\ 0 & 1 & -y_1 \\ 0 & 0 & 1 \end{bmatrix}$$
$$= \begin{bmatrix} \cos\theta & -\sin\theta & x_1(1 - \cos\theta) + y_1\sin\theta \\ \sin\theta & \cos\theta & y_1(1 - \cos\theta) - x_1\sin\theta \\ 0 & 0 & 1 \end{bmatrix}$$

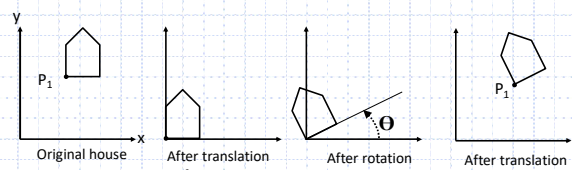


August 25, 2024Dr. Prashant K. Jain (IIITDM)25

Rotation and scaling about an arbitrary point

- Scale + rotate object around point P1 and move to P2


- P1 to origin
- Scale
- Rotate
- Translate to P2

$T(x_2, y_2) \cdot R(\theta) \cdot S(s_x, s_y) \cdot T(-x_1, -y_1)$

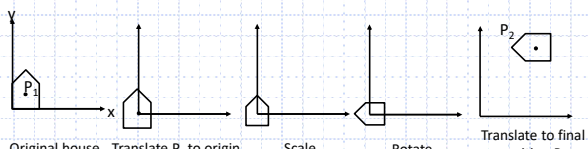

August 25, 2024Dr. Prashant K. Jain (IIITDM)26

Reflection about an arbitrary line

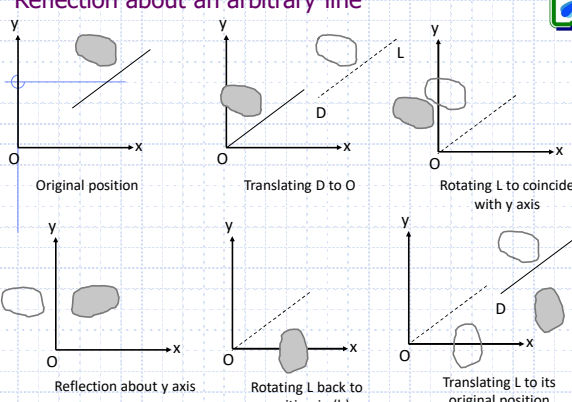

August 25, 2024Dr. Prashant K. Jain (IIITDM)27

Reflection about an arbitrary line

- Translate $(0, -b)$ so that the line passes through the origin.
- Rotate the line about the z axis by $-\theta^\circ$.
- Reflect object about the x axis.
- Rotate back the line by θ° .
- Translate back $(0, b)$.

$y = mx + b$

$\theta = \tan^{-1}(m)$

$$[T] = [T_t][T_r][R][T_r]^{-1}[T_t]^{-1}$$

August 25, 2024

Dr. Prashant K. Jain (IITDM)

28

Reflect triangle $(2,4), (4,6), (2,6)$ about line $y = \frac{1}{2}(x+4)$

August 25, 2024

Dr. Prashant K. Jain (IITDM)

29

Consider the line L and the triangle ABC shown in Figure. The equation of the line L is

$$y = \frac{1}{2}(x+4)$$

- The position vectors $\begin{bmatrix} 2 & 4 & 1 \end{bmatrix}$, $\begin{bmatrix} 4 & 6 & 1 \end{bmatrix}$ and $\begin{bmatrix} 2 & 6 & 1 \end{bmatrix}$ describe the vertices of the triangle ABC in homogeneous coordinate.

August 25, 2024

Dr. Prashant K. Jain (IITDM)

30

- The line L will pass through the origin by translating it -2 units in the y direction.
- The resulting line can be made coincident with the x -axis by rotating it, by $-\tan^{-1}(2/4) = -26.57$ about the origin (CW).
- Then reflect the triangle through the x -axis.

$$[T] = \begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & -2 & 1 \end{bmatrix} \begin{bmatrix} 2/\sqrt{5} & -1/\sqrt{5} & 0 \\ 1/\sqrt{5} & 2/\sqrt{5} & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & 1 \end{bmatrix}$$

August 25, 2024

Dr. Prashant K. Jain (IITDM)

31

- The transformed position vectors of the triangle are then rotated (by 26.57) and translated (by 2 units in the y direction) back to the original orientation.
- The combined transformation is:

$$[T] = \begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & -2 & 1 \end{bmatrix} \begin{bmatrix} 2/\sqrt{5} & -1/\sqrt{5} & 0 \\ 1/\sqrt{5} & 2/\sqrt{5} & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} 2/\sqrt{5} & 1/\sqrt{5} & 0 \\ -1/\sqrt{5} & 2/\sqrt{5} & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} 1 & 0 & 0 \\ 0 & 1 & 0 \\ 0 & 2 & 1 \end{bmatrix}$$

$$[T] = \begin{bmatrix} \frac{3}{5} & \frac{4}{5} & 0 \\ \frac{4}{5} & \frac{3}{5} & 0 \\ \frac{-8}{5} & \frac{16}{5} & 1 \end{bmatrix}$$

August 25, 2024

Dr. Prashant K. Jain (IITDM)

32

The transformed position for the triangle $A^*B^*C^*$ are


$$\begin{bmatrix} 2 & 4 & 1 \\ 4 & 6 & 1 \\ 2 & 6 & 1 \end{bmatrix} \begin{bmatrix} \frac{3}{5} & \frac{4}{5} & 0 \\ \frac{4}{5} & \frac{3}{5} & 0 \\ \frac{-8}{5} & \frac{16}{5} & 1 \end{bmatrix} = \begin{bmatrix} \frac{14}{5} & \frac{12}{5} & 1 \\ \frac{28}{5} & \frac{14}{5} & 1 \\ \frac{22}{5} & \frac{6}{5} & 1 \end{bmatrix}$$

August 25, 2024

Dr. Prashant K. Jain (IITDM)

33

Significance of order in transformation

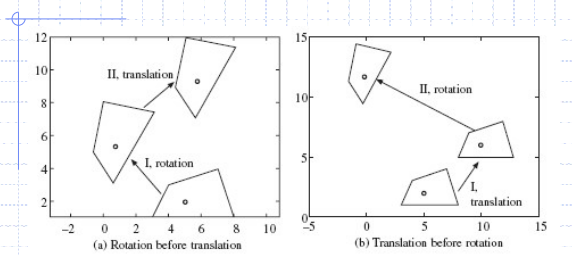

(a) Rotation before translation

(b) Translation before rotation

August 25, 2024Dr. Prashant K. Jain (IITDM)34

3D Rotation

- One rotation for each world coordinate axis

$$R_x(\theta) = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & \cos\theta & -\sin\theta & 0 \\ 0 & \sin\theta & \cos\theta & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$
$$R_y(\theta) = \begin{bmatrix} \cos\theta & 0 & \sin\theta & 0 \\ 0 & 1 & 0 & 0 \\ -\sin\theta & 0 & \cos\theta & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$
$$R_z(\theta) = \begin{bmatrix} \cos\theta & -\sin\theta & 0 & 0 \\ \sin\theta & \cos\theta & 0 & 0 \\ 0 & 0 & 1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

August 25, 2024Dr. Prashant K. Jain (IITDM)35

3D Shearing

- Shearing:

$$\begin{bmatrix} 1 & a & b & 0 \\ c & 1 & d & 0 \\ e & f & 1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ z \\ 1 \end{bmatrix} = \begin{bmatrix} x + ay + bz \\ cx + y + dz \\ ex + fy + z \\ 1 \end{bmatrix}$$

- Change in each coordinate is a linear combination of all three.
- Transforms a cube into a general parallelepiped.



August 25, 2024Dr. Prashant K. Jain (IITDM)37

3D Reflection


- A reflection through the xy plane:

$$\begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & -1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} x \\ y \\ z \\ 1 \end{bmatrix} = \begin{bmatrix} x \\ y \\ -z \\ 1 \end{bmatrix}$$

- Reflections through the xz and the yz planes are defined similarly.

August 25, 2024Dr. Prashant K. Jain (IITDM)38


Rotation about an axis parallel to a coordinate axis

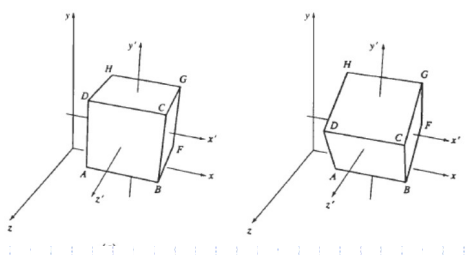

August 25, 2024Dr. Prashant K. Jain (IITDM)41

- Consider the block shown in figure by the position vectors relative to the global xyz-axis system.

$$[X] = \begin{bmatrix} 1 & 1 & 2 & 1 \\ 2 & 1 & 2 & 1 \\ 2 & 2 & 2 & 1 \\ 1 & 2 & 2 & 1 \\ 1 & 1 & 1 & 1 \\ 2 & 1 & 1 & 1 \\ 2 & 2 & 1 & 1 \\ 1 & 2 & 1 & 1 \end{bmatrix} \begin{matrix} A \\ B \\ C \\ D \\ E \\ F \\ G \\ H \end{matrix}$$

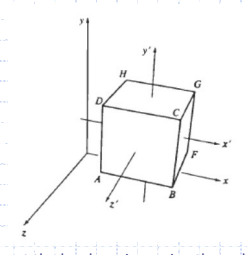

- Let's rotate the block by $\vartheta = +30^\circ$ about the local x-axis passing through the centroid of the block. The origin of the local axis system is assumed to be the centroid of the block

August 25, 2024Dr. Prashant K. Jain (IITDM)42

- The centroid of the block is $[x_c \ y_c \ z_c \ 1] = [3/2 \ 3/2 \ 3/2 \ 1]$.
- The rotation is accomplished by
$$[X'] = [X] \cdot [Tr] \cdot [R_x] \cdot [Tr]^{-1}$$
- where
$$[Tr] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ 0 & -y_c & -z_c & 1 \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ 0 & -\frac{3}{2} & -\frac{3}{2} & 1 \end{bmatrix}$$
$$[R_x] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & \cos\theta & \sin\theta & 0 \\ 0 & -\sin\theta & \cos\theta & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 0.866 & 0.5 & 0 \\ 0 & -0.5 & 0.866 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$


August 25, 2024Dr. Prashant K. Jain (IITDM)43

- and
$$[Tr]^{-1} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ 0 & \frac{3}{2} & \frac{3}{2} & 1 \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ 0 & \frac{3}{2} & \frac{3}{2} & 1 \end{bmatrix}$$
- The first matrix $[Tr]$ translates the block parallel to the $x=0$ plane until the x' -axis is coincident with that x -axis.
- The second matrix $[R_x]$ performs the required rotation about the x -axis,
- and the third matrix $[Tr]^{-1}$ translates the x' -axis and hence the rotated block back to its original position.

August 25, 2024Dr. Prashant K. Jain (IITDM)44


- Concatenating these three matrices yields.
$$[T] = [Tr] \cdot [R_x] \cdot [Tr]^{-1} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & \cos\theta & \sin\theta & 0 \\ 0 & -\sin\theta & \cos\theta & 0 \\ 0 & y_c(1 - \cos\theta) + z_c\sin\theta & z_c(1 - \cos\theta) - y_c\sin\theta & 1 \end{bmatrix}$$
- After subtracting numerical values the transformed coordinates are
$$[X'] = [X] \cdot [T] = \begin{bmatrix} 1 & 1 & 2 & 1 \\ 2 & 1 & 2 & 1 \\ 2 & 2 & 2 & 1 \\ 1 & 2 & 2 & 1 \\ 1 & 1 & 1 & 1 \\ 2 & 1 & 1 & 1 \\ 2 & 2 & 1 & 1 \\ 1 & 2 & 1 & 1 \end{bmatrix} \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 0.866 & 0.5 & 0 \\ 0 & -0.5 & 0.866 & 0 \\ 0 & 0.951 & -0.549 & 1 \end{bmatrix}$$

August 25, 2024Dr. Prashant K. Jain (IITDM)45
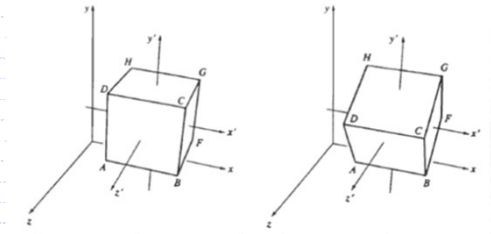
$$[X] = \begin{bmatrix} 1 & 1 & 2 & 1 & A \\ 2 & 1 & 2 & 1 & B \\ 2 & 2 & 2 & 1 & C \\ 1 & 2 & 2 & 1 & D \\ 1 & 1 & 1 & 1 & E \\ 2 & 1 & 1 & 1 & F \\ 2 & 2 & 1 & 1 & G \\ 1 & 2 & 1 & 1 & H \end{bmatrix} \quad [X'] = \begin{bmatrix} 1 & 0.817 & 1.683 & 1 & A \\ 2 & 0.817 & 1.683 & 1 & B \\ 2 & 1.683 & 2.183 & 1 & C \\ 1 & 1.683 & 2.183 & 1 & D \\ 1 & 1.317 & 0.817 & 1 & E \\ 2 & 1.317 & 0.817 & 1 & F \\ 2 & 2.183 & 1.317 & 1 & G \\ 1 & 2.183 & 1.317 & 1 & H \end{bmatrix}$$


August 25, 2024Dr. Prashant K. Jain (IITDM)46

Rotation about an arbitrary axis in 3D

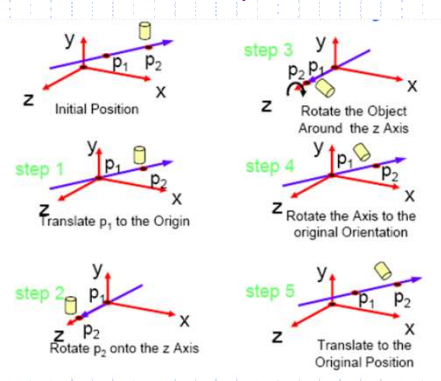


- Initial Position
- step 1 Translate p_1 to the Origin
- step 2 Rotate p_2 onto the z Axis
- step 3 Rotate the Object Around the z Axis
- step 4 Rotate the Axis to the original Orientation
- step 5 Translate to the Original Position

August 25, 2024Dr. Prashant K. Jain (IITDM)47

Rotation About an Arbitrary Axis in Space

- Translate so that the point (x_0, y_0, z_0) is at the origin of the coordinate system.
- Perform approximate rotation to make the axis of rotation with the z -axis.
- Rotate about the z -axis by the angle δ .
- Perform the inverse of the combined rotation transformation.
- Perform the inverse of the translation.

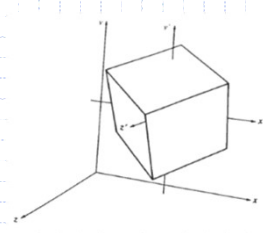


August 25, 2024Dr. Prashant K. Jain (IITDM)48

In general, making an arbitrary axis passing the origin coincide with one of the coordinate axes requires *two successive rotations about the other two coordinate axes*.

To make the arbitrary rotation axis coincident with the z-axis, first rotate about the x-axis and then about the y-axis.

To determine the rotation angle α about the x-axis used to place the arbitrary axis in the xz plane, first project the unit vector along the x-axis onto the yz plane. The y and z components of the projected vector are c_y and c_z , the direction cosine of the unit vector along the arbitrary axis.

$$d = \sqrt{c_y^2 + c_z^2}$$
$$\cos\alpha = \frac{c_z}{d}, \sin\alpha = \frac{c_y}{d}$$

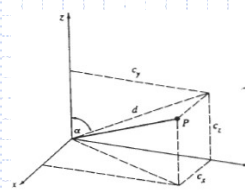


August 25, 2024

Dr. Prashant K. Jain (IIITDM)

49

After rotation about the x-axis into the xz plane, the z component of the unit vector is d , and the x component is c_x , the direction cosine in the x direction. Thus the rotation angle β about the y-axis required to make the arbitrary axis coincident with z-axis is

$$\cos\beta = d \quad \sin\beta = c_x$$

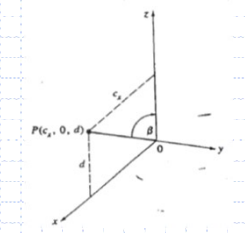

August 25, 2024

Dr. Prashant K. Jain (IIITDM)

50

Rotation About an Arbitrary Axis in Space

The complete transformation is then

$$[M] = [T] \cdot [R_x] \cdot [R_y] \cdot [R_\delta] \cdot [R_x]^{-1} \cdot [R_y]^{-1} \cdot [T]^{-1}$$

where the required translation matrix is

$$[T] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ -x_0 & -y_0 & -z_0 & 1 \end{bmatrix}$$

The transformation matrix for rotation about the x-axis is

$$[R_x] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & \cos\theta & \sin\theta & 0 \\ 0 & -\sin\theta & \cos\theta & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & c_z/d & c_y/d & 0 \\ 0 & -c_y/d & c_z/d & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

August 25, 2024

Dr. Prashant K. Jain (IIITDM)

51

And about the y-axis

$$[R_y] = \begin{bmatrix} \cos(-\beta) & 0 & \sin(-\beta) & 0 \\ 0 & 1 & 0 & 0 \\ -\sin(-\beta) & 0 & \cos(-\beta) & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} = \begin{bmatrix} d & 0 & c_x & 0 \\ 0 & 1 & 0 & 0 \\ -c_x & 0 & d & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

Finally, the rotation about the arbitrary axis is given by a z-axis rotation matrix

$$[R_\delta] = \begin{bmatrix} \cos\delta & \sin\delta & 0 & 0 \\ -\sin\delta & \cos\delta & 0 & 0 \\ 0 & 0 & 1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

August 25, 2024

Dr. Prashant K. Jain (IIITDM)

52

If the direction of the arbitrary axes are not known then they can be obtained knowing a second point on the axis (x_1, y_1, z_1) by normalizing the vector from the first to the second point. Specifically, the vector along the axis from (x_0, y_0, z_0) to (x_1, y_1, z_1) is

$$[V] = [(x_1 - x_0) \ (y_1 - y_0) \ (z_1 - z_0)]$$

Normalized, it yields

$$[c_x \ c_y \ c_z] = \frac{[(x_1 - x_0)(y_1 - y_0)(z_1 - z_0)]}{[(x_1 - x_0)^2 + (y_1 - y_0)^2 + (z_1 - z_0)^2]^{1/2}}$$

August 25, 2024


Dr. Prashant K. Jain (IIITDM)

53

Consider the cube with one corner removed

vectors for the vertices are

$$[X] = \begin{bmatrix} 2 & 1 & 2 & 1 \\ 3 & 1 & 2 & 1 \\ 3 & 1.5 & 2 & 1 \\ 2.5 & 2 & 2 & 1 \\ 2 & 2 & 2 & 1 \\ 2 & 1 & 1 & 1 \\ 3 & 1 & 1 & 1 \\ 3 & 2 & 1 & 1 \\ 2 & 2 & 1 & 1 \\ 3 & 2 & 1.5 & 1 \end{bmatrix} \begin{matrix} A \\ B \\ C \\ D \\ E \\ F \\ G \\ H \\ I \\ J \end{matrix}$$

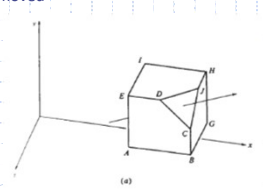

The cube is to be rotated by -45° about a local axis passing through the point F and the diagonally opposite corner. The axis is directed from F to the opposite corner and passes through the center of the corner face.

August 25, 2024

Dr. Prashant K. Jain (IIITDM)

54

Determine the direction cosine of the rotation axis. Observing that the corner cut off by the triangle CDJ also lies on the axis of rotation.

$$[C_x \ C_y \ C_z] = \frac{[(3-2)(2-1)(2-1)]}{[(3-2)^2 + (2-1)^2 + (2-1)^2]^{1/2}}$$

$$= \left[\frac{1}{\sqrt{3}} \ \frac{1}{\sqrt{3}} \ \frac{1}{\sqrt{3}} \right]$$

Using Equations

$$d = \sqrt{C_y^2 + C_z^2} \quad \cos \alpha = \frac{C_z}{d}, \quad \sin \alpha = \frac{C_y}{d} \quad \cos \beta = d, \quad \sin \beta = C_x$$

yields

$$d = \sqrt{\left(\frac{1}{\sqrt{3}}\right)^2 + \left(\frac{1}{\sqrt{3}}\right)^2} = \sqrt{\frac{2}{3}} \quad \alpha = \cos^{-1}\left(\frac{1/\sqrt{3}}{\sqrt{2/3}}\right) = \cos^{-1}\left(\frac{1}{\sqrt{2}}\right) = 45^\circ$$

$$\beta = \cos^{-1}\left(\frac{2}{3}\right) = 35.26^\circ$$

August 25, 2024 Dr. Prashant K. Jain (IITDM) 55

Since the point F lies on the rotation axis, the translation matrix and the rotation matrices to make the arbitrary axis coincident with the z -axis are


$$[T] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ -2 & -1 & -1 & 1 \end{bmatrix} \quad [R_z] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1/\sqrt{2} & 1/\sqrt{2} & 0 \\ 0 & -1/\sqrt{2} & 1/\sqrt{2} & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \quad [R_y] = \begin{bmatrix} 2/\sqrt{6} & 0 & 1/\sqrt{3} & 0 \\ 0 & 1 & 0 & 0 \\ -1/\sqrt{3} & 0 & 2/\sqrt{6} & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

Concatenating $[T][R_z][R_y]$ yields

$$[M] = [T] \cdot [R_z] \cdot [R_y] = \begin{bmatrix} 2/\sqrt{6} & 0 & 1/\sqrt{3} & 0 \\ -1/\sqrt{6} & 1/\sqrt{2} & 1/\sqrt{3} & 0 \\ -1/\sqrt{6} & -1/\sqrt{2} & 1/\sqrt{3} & 0 \\ -2/\sqrt{6} & 0 & -4/\sqrt{3} & 1 \end{bmatrix}$$

August 25, 2024 Dr. Prashant K. Jain (IITDM) 56

The transformed intermediate position vectors are
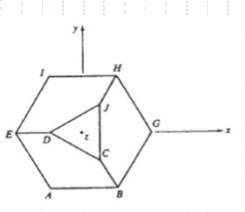
$$[X] \cdot [M] = \begin{bmatrix} -0.408 & -0.707 & 0.577 & 1 \\ 0.408 & -0.707 & 1.155 & 1 \\ 0.204 & -0.354 & 1.443 & 1 \\ -0.408 & 0 & 1.443 & 1 \\ -0.816 & 0 & 1.155 & 1 \\ 0 & 0 & 0 & 1 \\ 0.816 & 0 & 0.577 & 1 \\ 0.408 & 0.707 & 1.155 & 1 \\ -0.408 & 0.707 & 0.577 & 1 \\ 0.204 & 0.354 & 1.443 & 1 \end{bmatrix}$$


Notice that point F is at $(0, 0, 0)$

August 25, 2024 Dr. Prashant K. Jain (IITDM) 57

The rotation about the arbitrary axis is now given by the equivalent rotation about the z -axis.

$$[R_z] = \begin{bmatrix} \sqrt{2}/2 & -\sqrt{2}/2 & 0 & 0 \\ \sqrt{2}/2 & \sqrt{2}/2 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$


The transformed object is returned to its 'original' position in space, using

$$[M]^{-1} = [R_z]^{-1} \cdot [R_y]^{-1} \cdot [T]^{-1} = \begin{bmatrix} 2/\sqrt{6} & -1/\sqrt{6} & -1/\sqrt{6} & 0 \\ 0 & 1/\sqrt{2} & -1/\sqrt{2} & 0 \\ 1/\sqrt{3} & 1/\sqrt{3} & 1/\sqrt{3} & 0 \\ 2 & 1 & 1 & 1 \end{bmatrix}$$

This result can be obtained by concatenating the inverse of the individual component matrices of $[M]$ or by formally taking the inverse of $[M]$. $[R_z]^{-1}$, $[R_y]^{-1}$, and $[T]^{-1}$ are obtained by substituting $-\alpha$, $-\theta$ and (x_o, y_o, z_o) for α , θ and $(-x_o, -y_o, -z_o)$, respectively.

August 25, 2024 Dr. Prashant K. Jain (IITDM) 58

The resulting position vectors are
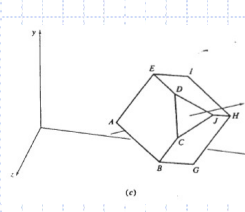
$$[X] \cdot [M] \cdot [R_z] \cdot [R_y] \cdot [T]^{-1} = \begin{bmatrix} 1.689 & 1.506 & 1.805 & 1 \\ 2.494 & 1.195 & 2.311 & 1 \\ 2.747 & 1.598 & 2.155 & 1 \\ 2.598 & 2.155 & 1.747 & 1 \\ 2.195 & 2.311 & 1.494 & 1 \\ 2 & 1 & 1 & 1 \\ 2.805 & 0.689 & 1.506 & 1 \\ 3.311 & 1.494 & 1.195 & 1 \\ 2.506 & 1.805 & 0.689 & 1 \\ 3.155 & 1.747 & 1.598 & 1 \end{bmatrix}$$


August 25, 2024 Dr. Prashant K. Jain (IITDM) 59

Reflection Through an Arbitrary Plane

- Translate a known point P , that lies in the reflection plane, to the origin of the coordinate system.
- Rotate the normal vector to the reflection plane at the origin until it is coincident with the $+z$ -axis; this makes the reflection plane the $z=0$ coordinate plane.
- After applying the above transformations to the object, reflect the object through the $z=0$ coordinate plane
- Perform the inverse transformations to those given above to achieve the desired result.


The general transformation is then:

$$[M] = [T] \cdot [R_x] \cdot [R_y] \cdot [R_z] \cdot [R_y]^{-1} \cdot [R_x]^{-1} \cdot [T]^{-1}$$

Where the matrices $[T]$, $[R_x]$, $[R_y]$ are obtained for translation and rotations, respectively. $(x_o, y_o, z_o) = (P_x, P_y, P_z)$, the components of point P in the reflection plane; and (c_x, c_y, c_z) are the direction cosines of the normal to the reflection plane.

August 25, 2024 Dr. Prashant K. Jain (IITDM) 60

Consider the cube with one corner removed
vectors for the vertices are:

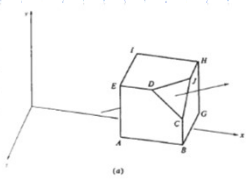
$$[X] = \begin{bmatrix} 2 & 1 & 2 & 1 \\ 3 & 1 & 2 & 1 \\ 3 & 1.5 & 2 & 1 \\ 2.5 & 2 & 2 & 1 \\ 2 & 2 & 2 & 1 \\ 2 & 1 & 1 & 1 \\ 3 & 1 & 1 & 1 \\ 3 & 2 & 1 & 1 \\ 2 & 2 & 1 & 1 \\ 3 & 2 & 1.5 & 1 \end{bmatrix} \begin{matrix} A \\ B \\ C \\ D \\ E \\ F \\ G \\ H \\ I \\ J \end{matrix}$$


The cube is to be reflected through the plane containing the triangle CDJ.

August 25, 2024Dr. Prashant K. Jain (IITDM)61

The normal to the reflection plane is obtained using the position vectors C, D, J.

Specifically, taking the cross product of the vectors CJ and CD prior to translation yields
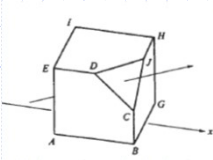
$$\begin{aligned} n &= ([J] - [C]) \times ([D] - [C]) \\ &= [(3 - 3) \ (2 - 1.5) \ (1.5 - 2)] \times [(2.5 - 3) \ (2 - 1.5) \ (2 - 2)] \\ &= [0 \ 1/2 \ -1/2] \times [-1/2 \ 1/2 \ 0] \\ &= [1/4 \ 1/4 \ 1/4] \end{aligned}$$


August 25, 2024Dr. Prashant K. Jain (IITDM)62

Translate the point C to the origin, yield the translation matrix

$$[T] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ -3 & -3/2 & -2 & 1 \end{bmatrix}$$

The rotation matrices to make the normal at C coincide with z-axis are

$$[R_x] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1/\sqrt{2} & 1/\sqrt{2} & 0 \\ 0 & -1/\sqrt{2} & 1/\sqrt{2} & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \quad [R_y] = \begin{bmatrix} 2/\sqrt{6} & 0 & 1/\sqrt{3} & 0 \\ 0 & 1 & 0 & 0 \\ -1/\sqrt{3} & 0 & 2/\sqrt{6} & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$


August 25, 2024Dr. Prashant K. Jain (IITDM)63

Concatenating [T], [R_x] and [R_y] yields

$$[M] = [T] \cdot [R_x] \cdot [R_y] = \begin{bmatrix} 2/\sqrt{6} & 0 & 1/\sqrt{3} & 0 \\ -1/\sqrt{6} & 1/\sqrt{2} & 1/\sqrt{3} & 0 \\ -1/\sqrt{6} & -1/\sqrt{2} & 1/\sqrt{3} & 0 \\ -5/2\sqrt{6} & 1/2\sqrt{2} & -13/2\sqrt{3} & 1 \end{bmatrix}$$

August 25, 2024Dr. Prashant K. Jain (IITDM)64

The transformed intermediate position vectors are
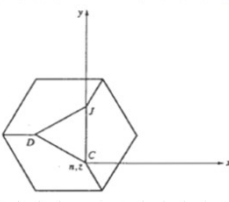
$$[X] \cdot [M] = \begin{bmatrix} -0.612 & -0.354 & -0.876 & 1 \\ 0.204 & -0.354 & -0.287 & 1 \\ 0 & 0 & 0 & 1 \\ -0.612 & 0.354 & 0 & 1 \\ -1.021 & 0.354 & -0.287 & 1 \\ -0.204 & 0.354 & -1.443 & 1 \\ 0.612 & 0.354 & -0.876 & 1 \\ 0.204 & 1.061 & -0.287 & 1 \\ -0.612 & 1.061 & -0.876 & 1 \\ 0 & 0.707 & 0 & 1 \end{bmatrix}$$


Notice that the point C is at the origin and the z-axis points out of the screen.

August 25, 2024Dr. Prashant K. Jain (IITDM)65

Reflection through the arbitrary plane is now given by reflection through the z=0 plane.

$$[Rfl] = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & -1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$


Returning the transformed object to its 'original' position in space requires

$$[M]^{-1} = [R_y]^{-1} \cdot [R_x]^{-1} \cdot [T]^{-1} = \begin{bmatrix} 2/\sqrt{6} & -1/\sqrt{6} & -1/\sqrt{6} & 0 \\ 0 & 1/\sqrt{2} & -1/\sqrt{2} & 0 \\ 1/\sqrt{3} & 1/\sqrt{3} & 1/\sqrt{3} & 0 \\ 3 & 3/2 & 2 & 1 \end{bmatrix}$$

The matrices [R_x]⁻¹, [R_y]⁻¹ and [T]⁻¹ are obtained by substituting -α, -β, and [x₀ y₀ z₀] = C.

August 25, 2024Dr. Prashant K. Jain (IITDM)66

The resulting position vectors are

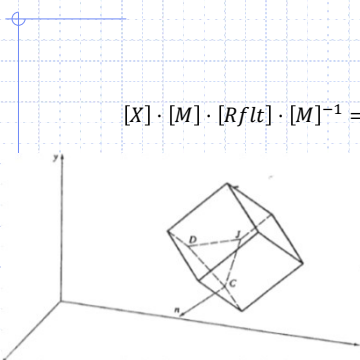


$$[X] \cdot [M] \cdot [Rflr] \cdot [M]^{-1} = \begin{bmatrix} 3 & 2 & 3 & 1 \\ 10/3 & 4/3 & 7/3 & 1 \\ 3 & 3/2 & 2 & 1 \\ 5/2 & 2 & 2 & 1 \\ 7/3 & 7/3 & 7/3 & 1 \\ 11/3 & 8/3 & 8/3 & 1 \\ 4 & 2 & 2 & 1 \\ 10/3 & 7/3 & 4/3 & 1 \\ 3 & 3 & 2 & 1 \\ 3 & 2 & 3/2 & 1 \end{bmatrix}$$

August 25, 2024

Dr. Prashant K. Jain (IIITDM)

67

THANK YOU

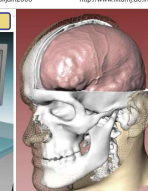

Dr. Prashant K. Jain
Professor (H.C. Discipline)

IIITDM Jabalpur

PDPM
INDIAN INSTITUTE OF INFORMATION TECHNOLOGY,
DESIGN & MANUFACTURING, JABALPUR
(An Institute of National Importance, established by MHRD, Govt. of India)

Ph. +91-761-2794415
Cell. +91-94250-02010
Email: prashant@iiitdm.ac.in
@prashant2008 @prashant2008

Dumna Airport Road,
P.O. Dumna
Jabalpur-482 005, (M.P.), India
<http://www.iiitdm.ac.in>

August 25, 2024

Dr. Prashant K. Jain (IIITDM)

71